


## Dehydrátory pájecí tužkové (chladničkové)

Univerzální - s náplní HX9, vhodné pro R-12, R-134a, R-404A, 507 a R-600a.

Typ	Náplň g	Délka L mm	Vývody A-C-B ø mm	Registr. číslo
XS 210	10	123	2 x 6,2 + 2,5	7240000.720 C
XS 215	15	125	2 x 6,2 + 2,5	7240000.718 C
XS 220	20	150	2 x 6,2 + 2,2	7240000.725 C
XS 225	25	154	2 x 6,2 + 2,5	7240000.726 C
XS 230	30	160	2 x 6,2 + 2,5	7240000.730 C
XS 231	30	160	3 x 6,2	7240000.716
XS 315	15	160	2 x 6,2 + 2,5	7240000.710 C
XS 320	20	160	2 x 6,2 + 2,5	7240000.711 C
XS 350	50	160	3 x 6,2	7240000.750

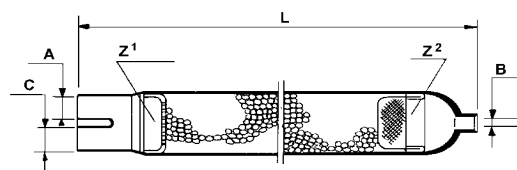

## Dehydrátory sací – KENMORE

BURN OUT FILTER (filtry pro spáleniny)

Typ	Objem cm <sup>3</sup>	Vývody		Délka mm	Registr. číslo
		inch	mm		
WSL – 163 S	262	3/8	10	154	7242000.800
WSL – 164 S	262	1/2	12	154	7242000.801
WSL – 305 S	492	5/8	16	202	7242000.805
WSL – 165 S	492	5/8	16	202	7242000.806
WSL – 166 S	262	3/4	18	167	7242000.804
WSL – 167 S	262	7/8	22	179	7242000.803
WSL – 307 S	492	7/8	22	214	7242000.808
WSL – 419 S	672	1 1/8	28	270	7242000.807
WSL – 7513 S	1 229	1 5/8	42	367	7242000.810

## Filtry sací – FC

Sací filtry pro zachycení mechanických nečistot

Typ	Objem cm <sup>3</sup>	Vývody		Délka mm	Registr. číslo
		inch	mm		
SSR – 283T	262	3/8	10	142	7242000.800C
SSR – 284T	262	1/2	12	144	7242000.801C
SSR – 285T	262	5/8	16	162	7242000.806C
SSR – 286T	492	3/4	18	196	7242000.804C
SSR – 287T	492	7/8	22	200	7242000.803C
SSR – 289T	492	1 1/8	28	209	7242000.807C
SSR – 2811T	492	1 3/8	35	274	7242000.809C

